STANDARD RANGES



Series DPG-100 Digital Pressure Gage

Specifications - Installation and Operating Instructions



CERAMIC RANGES [76.20] [40.39] Dwyer. 3-5/8[91.39] [95.25] 1/4 NPT

The **SERIES DPG-100** Digital Pressure Gage has a precise $\pm 0.25\%$ full scale accuracy. The 4 digit digital display will reduce the potential for errors in readings by eliminating parallax error commonly produced with analog gages

The DPG-100 is packaged in a durable extruded aluminum case designed to meet NEMA 4/4X. The unit is battery powered and has an auto-shut off to conserve battery life. A four button key pad allows easy access to features without the need to work through complex menus or difficult key combinations. These features include backlight, peak and valley, auto zero and conversion of the pressure units. Readings may be converted to various engineering units. See reverse page for available units.

DPG Quick Start Button Operation

For complete detailed instructions on the four button operation see the Operation Chart provided on back.



On/Backlight: Push to turn on; Press again for backlight. Press and hold for 5 seconds to turn unit off.



Zero: Zeros the display - Press the ZERO button until dashes "-are seen on the LCD, then release the button. If after pressing zero the display does not re-zero, the unit is no longer meeting specified accuracy and should be sent back to the factory for calibration. Do not use the zero button when pressure is applied.



Units: Scroll (see next page for Model/Range Chart).



P/V: Peak recorded reading retrieved by initial push of button; push again retrieves the valley or lowest value recorded.

INSTALLATION

When installing gage always use 1" hex at the base of the housing to tighten the gage to a mating fitting. Do not apply wrench to housing.

MAINTENANCE

A "LOW BAT" descriptor indication will appear on the display when batteries need to be replaced.

Battery Replacement: Remove the three screws on backplate. Lift backplate off by hand. Replace batteries per polarity indicators. To reassemble, ensure O-ring seats into housing evenly and press until seated completely. Replace screws.



Substitution of components may impair intrinsic safety. Batteries must be changed in a non-hazardous location only. DO NOT mix batteries from different manufacturers. DO NOT mix old batteries with new batteries. Use 1.5 volt AAA alkaline batteries Duracell® MN2400.

WARNING

Enclosure parts are constructed of plastic. When cleaning the exterior surfaces use a damp cloth to avoid electrostatic sparking.



Enclosure parts are constructed of aluminum. Enclosure must be protected from mechanical friction and impact with iron/steel to prevent ignition capable sparks.

SPECIFICATIONS

Service: Liquids and combustible compatible gases (for FM listings see agency approvals below). **Wetted Materials:** Type 316L SS.

Housing Materials: Black polycarbonate front & back cover, anodized aluminum extruded housing with recessed grooves, polycarbonate overlay, Buna-N O-rings, 316L SS sensor construction.

Accuracy: 0.25% full scale; Ceramic Ranges: 0.5% full scale; ±1 least significant digit @ 70°F (21°C). (Includes linearity, hysteresis, repeatability).

Pressure Limit: 2x pressure range for models ≤1000 psi;5000 psi for 3000 psi range;7500 psi for 5000 psi range.

Enclosure Rating: Designed to meet NEMA 4/4X (IP65).

Temperature Limits: 0 to 130°F

(-18 to 55°C)

Thermal Effect: Between 70 to 130°F is 0.016%/F; Between 32 to 70°F is 0.026%/F; Between 10 to 32°Fis 0.09%/F; Between 0 to 10°Fis 0.50%/F.

Size: 3.00" OD x 1.90 deep (max). Process Connection: 1/4" male NPT. Weight: 8.84 oz (275 g).

Display: 4 digit (.425 H x .234W digits).

Sample Rate: 2 sec.

Power Requirements: (2) AAA alkaline batteries, included, user replaceable.

Battery Life: 2000 hours typical; low battery indicator (60 hours in continuous use).

Auto Shut-Off: Gage: 60 minute auto shut-off. Auto shut-off may be disengaged; Backlight: 2 minute auto shut-off.

Agency Approvals: FM, CE.

*Note: Gages with ceramic sensor are not CE and FM approved.


WARNING: DO NOT pressurize DPG over maximum allowable pressure limits. Extreme damage can occur if limits are exceeded (see Pressure Limit under Specifications). An overflow "OFL" designator will flash to acknowledge that the gage's pressure range has been exceeded.

PANEL MOUNT OPTION


Phone: 219/879-8000

Fax: 219/872-9057

Drill a 3-1/4" (82.55) diameter hole in a panel, locate three mounting holes for a #6 screw 120° apart on a 3-58" (92.08) bolt circle.

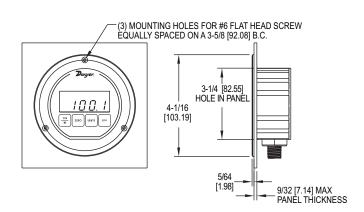

e-mail: info@dwyermail.com

 

DPG Button Operation										
Button	Operation	Action								
	Turn Unit On	Press and hold ON button								
	Turn Backlight On (Auto Shut-Off: 2 Min)	While gage is on press ON button								
	Turn Backlight Off	While backlight is on press ON button								
	Turn Unit Off	While gage is on, press and hold ON button 5 seconds for unit to turn off.								
	Zero Gage	With no pressure applied to the gage, press the ZERO button until dashes ""								
ZERO		are seen on the LCD, then release								
		If gage will not zero, then gage is no longer meeting specified accuracy and								
		should be sent back to the factory for recalibration								
		Note: Gage is not to be zeroed while pressure is applied								
UNIT	Unit Selection	Press UNIT button to change units on gage (Not all units are available for each								
		range, please refer to model/range chart located below for available units)								
	View Peak	Press P/V button to read peak (highest pressure) measurement								
P/v	View Valley	Press P/V button again to read valley (lowest pressure) measurement								
	Reset Peak & Valley	Press and hold P/V button to reset peak and valley								
	Exit Peak & Valley	Press ON button to exit peak/valley								
ON plus PV	Disengage Auto Shut-Off	Auto shut-off will turn off an idle gage after 60 minutes. To disengage auto shut-								
		off, press and hold ON button, then press and hold P/V button. A decimal will								
		blink in the lower left hand corner of the display to indicate the auto-shut off is								
		turned off. To turn on auto shut-off, repeat above procedure until decimal point								
		stops blinking								

Model/Range Chart												
		Pressure Ranges										
Model	Range psi	kg/cm ²	bar	in Hg	ft wc	kPa	oz/in ²	in wc	mbar	cm wc	mm Hg	
DPG-100*	-14.70-0	-1.033	-1.013	-29.93	-33.94	-101.4	-235.2	-407.3	-1013	-1034	-760.7	
DPG-102	15.00	1.055	1.034	30.54	34.61	103.4	240	415.2	1034	1055	775.7	
DPG-103	30.00	2.109	2.069	61.08	69.21	206.9	480	830.4	2069	2109	1551	
DPG-104	50.00	3.515	3.448	101.8	115.4	344.8	800	1384	3448	3515	2586	
DPG-105	100.0	7.03	6.895	203.6	230.7	689.5	1600	2768	6895	7031	5172	
DPG-106	200.0	14.06	13.79	407.2	461.4	1379	3200	5536				
DPG-107	300.0	21.09	20.69	610.8	692.1	2069	4800	8304				
DPG-108	500.0	35.15	34.48	1018	1154	3448	8000					
DPG-109	1000	70.3	68.98	2036	2307	6895						
DPG-110	3000	210.9	206.9	6108	6921							
DPG-111*	5000	351.5	344.8									

Compound Ranges available: DPG-120* Range: 30" Hg-0-15 psi; DPG-121* Range: 30" Hg-0-30 psi; DPG-122* Range: 30" Hg-0-45 psi; DPG-123*: Range 30" Hg-0-60 psi; DPG-124*: 30" Hg-0-100 psi.

Phone: 219/879-8000

Fax: 219/872-9057

www.dwyer-inst.com

e-mail: info@dwyermail.com

^{*}Optional ceramic sensor available. Add "C" to the range (Ex. DPG-100C).